



10 – Buffet

Vibraciones y Aeroelasticidad
Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70


ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP:689 45 44 70

ESCUELA TECNICA SUPERIOR DE INGENIERIA AERONAUTICA Y DEL ESPACIO

www.cartagena99.com no se hace responsable de la información contenida en el presente documento en virtud al

Artículo 17.1 de la Ley de Servicios de la Sociedad de la Información y de Comercio Electrónico, de 11 de Julio de 2002.
Si la información contenida en el documento es ilícita o lesiona bienes o derechos de un tercero háganoslo saber y será retirada.

UNIVERSIDAD POLITÉCNICA DE MADRID

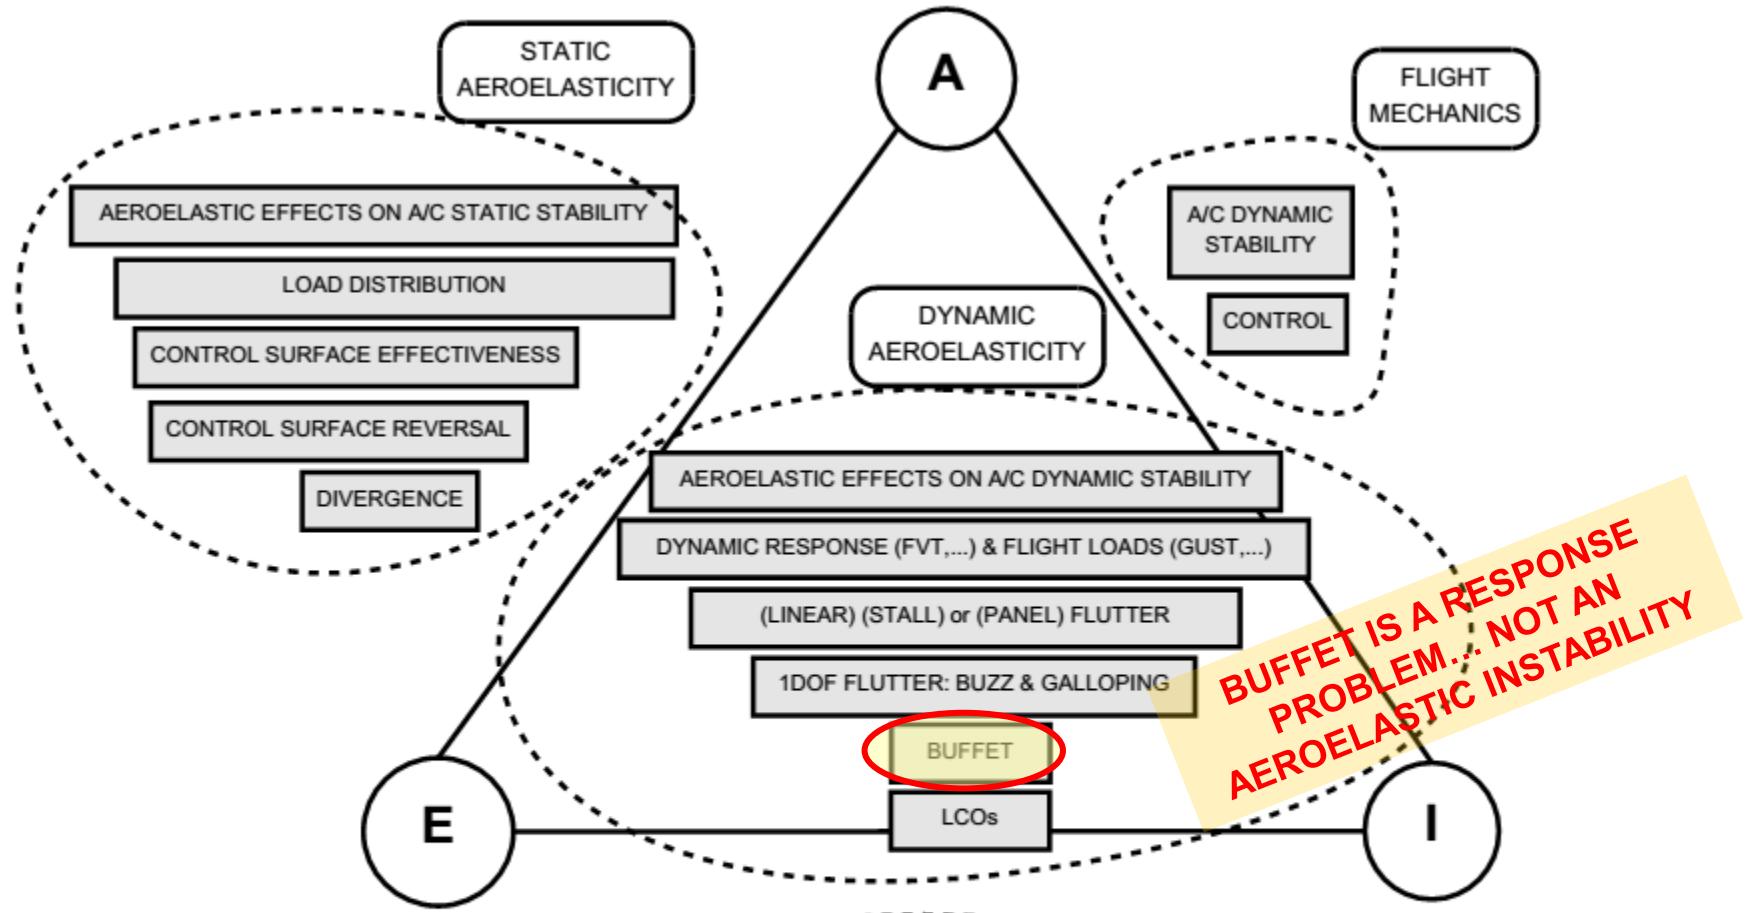

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70

IMPACT LOADS

THE FIRST ACCIDENT RELATED TO BUFFET ONSET


JUNKERS F13 crashed at Meopham, England, July 21, 1930



The Junkers F.13ge registered G-AAZK which was owned by the pilot Lieutenant-Colonel George Henderson had been loaned to the Walcot Air Line to operate a charter flight between Le Touquet in France and Croydon Airport south of London. As the aircraft was above Kent it appeared to have disintegrated and crashed near the village green at Meopham five miles south of Gravesend. Witnesses reported a rumbling noise just before the crash and that the aircraft emerged from a cloud and then broke apart in mid-air. The crash happened at 2:35 pm.

The final report was issued in January 1931 and the committee concluded the cause to be the "failure of the tailplane under **severe buffeting from air eddies produced by the centre section of certain low-wing monoplanes when the aircraft approaches the stalling attitude**".


They reported that the aircraft, flying in clouds, may have been thrown into an unusual attitude. This resulted in buffeting of the tailplane, causing the port tailplane to fail, and the aircraft entered a dive. The flutter effect on the starboard tailplane caused it to fail next. The aircraft was moving at high speed and reached a stalling attitude, causing the port wing to break away. The rapid angular acceleration caused the engine supports to break and the

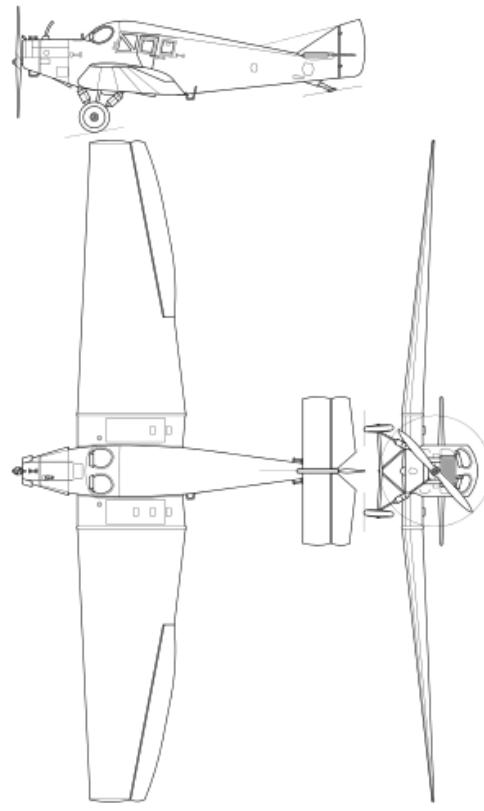

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70



GENERAL CONSIDERATIONS

- **BUFFET** is the excitation given to a structure by **separated flows**:
 - ▶ The excitation at a point may be generated by:
 - (a) a local separation (e.g. pod/pylon separation,...)
 - (b) an upstream separation (e.g. when a rear tailplane is immersed in a separated wake from a wing, an aircraft flying thru the wake of othr aircraft, ...)
 - (c) a downstream separation (e.g. when a rear fuselage is excited by separations on the afterbody)
 - ▶ The excitation covers a wide range of frequencies and is **RANDOM** in character. However, in certain separated flows the excitation may be confined to a single frequency and be periodic (e.g. flow around an antenna or any other aircraft excrescence).


- **BUFETTING** is the response of the structure to the buffet excitation:
 - ▶ The structure acts as a selective filter and may response both in its main structural modes (often in the first bending and torsional modes) or in local panel modes, which are often of higher frequencies.
 - ▶ The response of the structure leaves the buffet excitation essentially unaltered → **UNCOUPLED** response

Cartagena99


CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP:689 45 44 70

TRANSPORT vs COMBAT AIRCRAFT

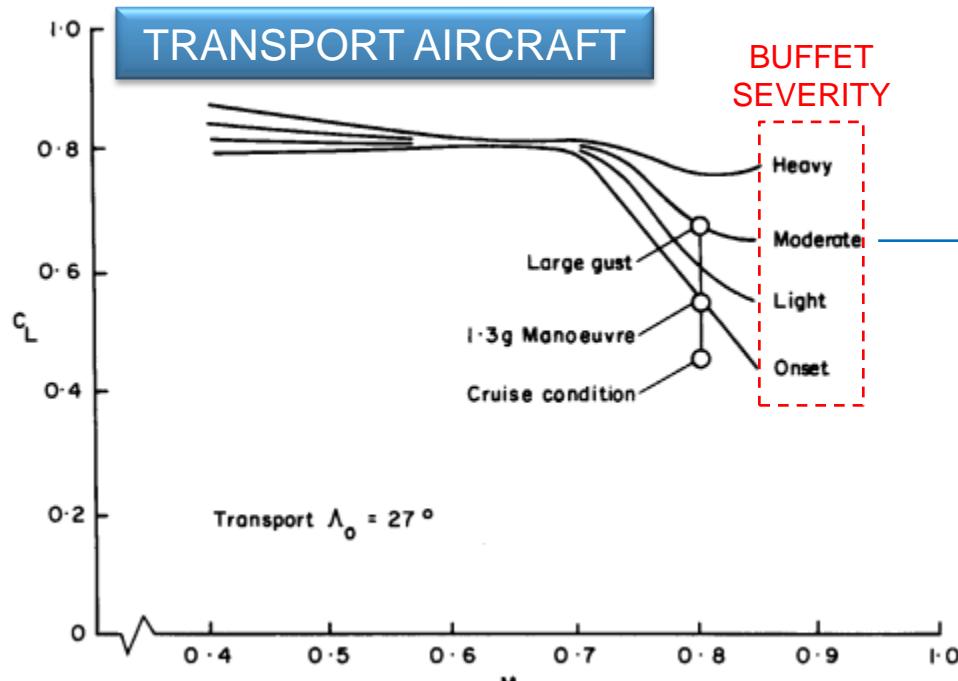

Buffet can lead to high design loads if appears in the gust encountering event

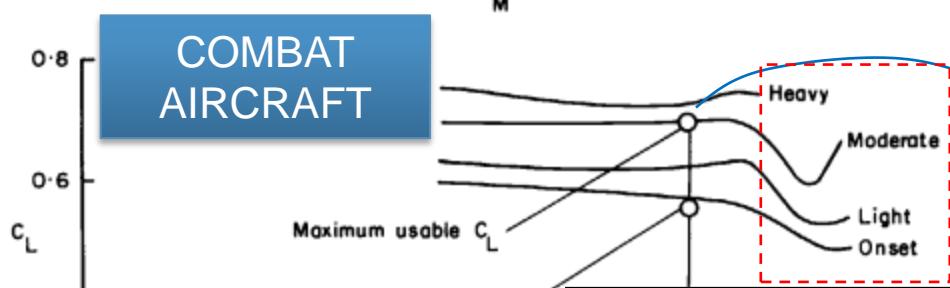

Buffet can effect to fatigue life as combat aircraft perform high-perfo maneuvers

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70

TYPES OF FLOW SEPARATIONS



LOCAL FLOW SEPARATIONS

Boeing
KC-767A Tanker



FLIGHT
INTERNATIONAL

The unexpected vibration cropped up during flight tests when airflow separation around the pylon connecting the refuelling pod to the wing set up a buffet in the structure. "We're working it hard and aggressively, and we have what we believe is a solution," says Boeing. "We are discussing that with the Italians right now."

UPSTREAM FLOW SEPARATION



Figure 1. NASA F-18 High Angle of Attack Research Vehicle (HARV). Photo Courtesy of NASA Dryden.

LOCAL/DOWNSTREAM SEPARATION



- High-frequency pressure sensor
 - Shock wave
 - Area of separated flow
 - Shock wave
 - Area of separated flow
- $\alpha = 5.88^\circ$ (buffet onset)
- $\alpha = 9.08^\circ$

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70


ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70



Cartagena99

TAIL BUFFETING INDUCED BY UPSTREAM WING STALL FLOW SEPARATION

WING STALL BOUNDARIES

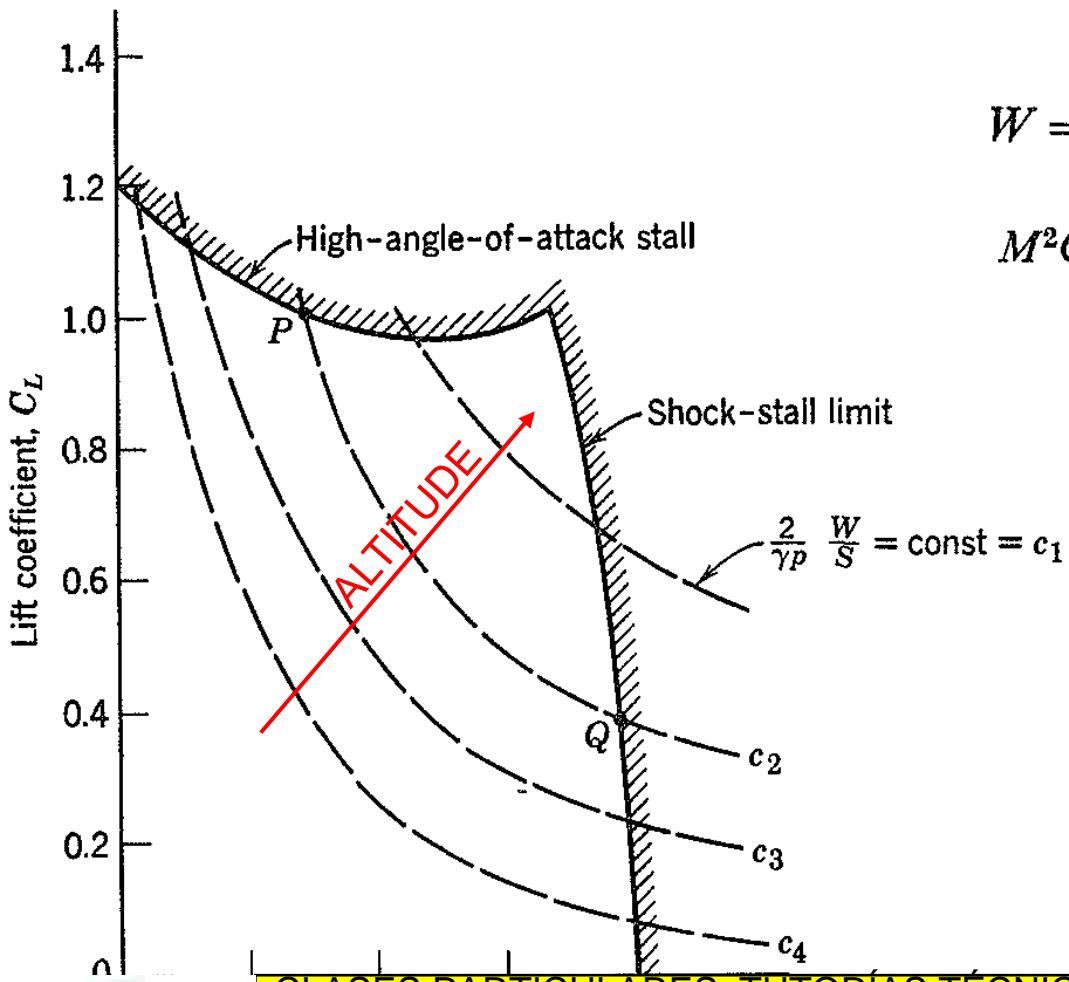

$$W = L = \frac{1}{2} \rho U^2 S C_L$$

$$M^2 C_L = \frac{W}{S} \frac{2}{\rho a^2} = \frac{W}{S} \frac{2}{\gamma p}$$

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70

ENGINEERING SIMULATION OF BUFFET CONDITIONS

RANDOM PSD ANALYSES BASED ON ACCELERATION MEASUREMENTS



- Unfortunately no theoretical method is yet available to predict the random excitation normally characteristic of buffet onset.
- Current industrial method is based on inferring buffet PSD input from flight test or wind tunnel test measurements. Example:

$$\text{PSD}_{\text{OUTPUT}} = |\mathcal{H}(\omega)|^2 \cdot \text{PSD}_{\text{INPUT}} \Rightarrow \text{PSD}_{\text{INPUT}} = \text{PSD}_{\text{OUTPUT}} / |\mathcal{H}(\omega)|^2$$

$\text{PSD}_{\text{OUTPUT}}$ → Accelerations from Flight Test Data measured at different locations

$\mathcal{H}(\omega)$ → Harmonic-Gust Frequency Response Function (obtained with Aeroelastic Model).

$\text{PSD}_{\text{INPUT}}$ → Unknown but ... the right one to obtain $\text{PSD}_{\text{OUTPUT}}$ through $\mathcal{H}(\omega)$.



BUFFET EXCITATION
(INPUT)



LOADS MODEL
(TRANSFER
FUNCTION)



FLIGHT TEST
DATA
(OUTPUT)

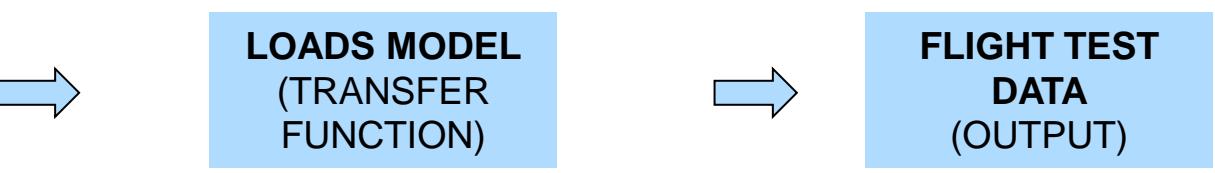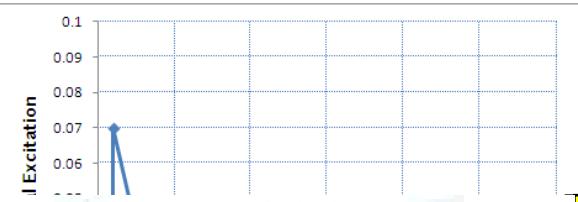

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70

FREQUENCY [Hz]

www.cartagena99.com no se hace responsable de la información contenida en el presente documento en virtud al Artículo 17.1 de la Ley de Servicios de la Sociedad de la Información y de Comercio Electrónico, de 11 de julio de 2002, ESTA INFORMACIÓN PUEDE SER DE NATUREZ ALIMENTARIA, DE LA SALUD, DE LOS BIENES PROTEGIDOS POR UN TERCERO HAGA PELIGROSA Y SE DEBE RETIRAR.

Vibraciones y Aeroelasticidad

ALLEVIGATION OF BUFFET

- Eliminate or at least reduce flow separations
 - ▶ Improve stall behavior: reducing the leading-edge suction by deflecting slats at leading edge in high angle-of-attack conditions
 - ▶ Boundary layer wing fences (or “stall fences”) to reduce spanwise flow tendency
 - ▶ Leading edge blowing and blown flaps to reduce or delay onset flow separation

- If separation cannot be prevented...
stabilization of separations:
 - ▶ The stabilized separations have much lower levels of buffet and generally have lower drags
 - ▶ Vortex generators, streamwise strakes, base-bleed, ...

- Active control:
 - ▶ Increase aerodynamic damping



MiG-17 with wing fences



Cartagena99


CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP:689 45 44 70


PRACTICAL EXAMPLE: STRUCTURAL REINFORCEMENT TO REMOVE NORMAL MODES FROM THE BUFFET EXCITATION

Aircraft excrescence (point FRU) creates a turbulence flow than affect to the “water door”, a plate located downstream the excrescence (point A)

The characteristic frequency of the eddies is shown in the flight envelope (70 [Hz], 100 [Hz], ...)

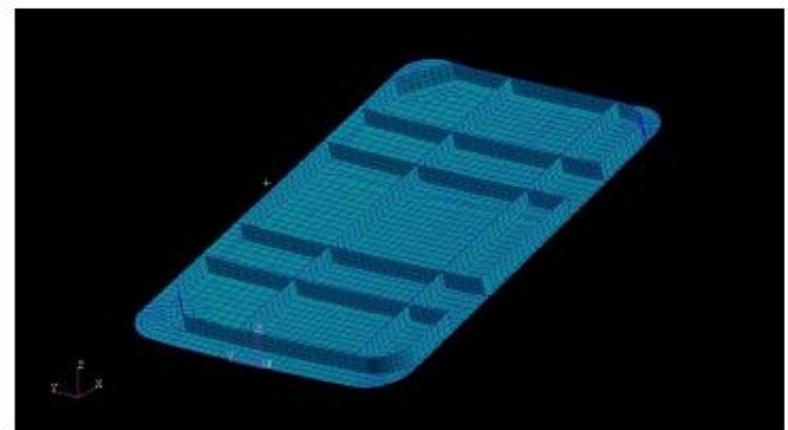

The original “water door” low-freq normal modes coupled with turbulence. The updated design (reinforced plate shown above) moved up the lowest frequency up to 130 [Hz] and decoupled the structural modes from the excitation.

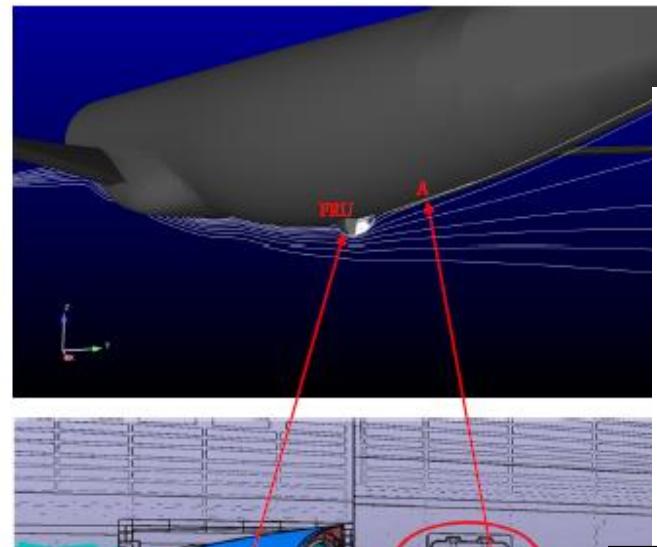

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70



“Escuela Técnica Superior de Ingeniería Aeronáutica y del Espacio”

UNIVERSIDAD POLITÉCNICA DE MADRID

Cartagena99

CLASES PARTICULARES, TUTORÍAS TÉCNICAS ONLINE
LLAMA O ENVÍA WHATSAPP: 689 45 44 70

ONLINE PRIVATE LESSONS FOR SCIENCE STUDENTS
CALL OR WHATSAPP: 689 45 44 70